PAGE: 1

PRINT DATE: 4/1/98

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL HARDWARE

NUMBER: 05-5-803-7 -X

SUBSYSTEM NAME: DATA PROCESSING SYSTEM (DPS)

REVISION: 9

01/10/94

PART DATA

PART NAME

PART NUMBER

VENDOR NAME

VENDOR NUMBER

LRU

LRU

: MULTIPLEXER-DEMULTIPLEXER

MC615-0004-5410

HONEYWELL

4020534-944

: MULTIPLEXER-DEMULTIPLEXER

MC615-0004-5410 4020534-964

HONEYWELL

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

OPERATIONAL INSTRUMENTATION AFT MDM: "OA1", "OA2", AND "OA3".

REFERENCE DESIGNATORS:

54V75A13

55V75A14

56V75A15

QUANTITY OF LIKE ITEMS: 3

THREE

FUNCTION:

UPON REQUEST, PROVIDES DIGITIZED AND PROCESSED DATA TO THE PULSE CODE MODULATION (PCM) MASTER UNIT FOR OPERATIONAL INSTRUMENTATION WHERE IT IS INTERLEAVED WITH ALL OTHER DATA INTO ONE SERIAL PCM STREAM. PROVIDES AUXILIARY POWER UNITS (APU) TEST LINE, FUEL LINE, FUEL PUMP DRAIN LINE, AND FUEL ISOLATION VALVE TEMPERATURE STATUS TO PREVENT HYDRAZINE DETONATION, PLUS FUEL TANK LEAK MONITORING CAPABILITIES.

CA MOMS ARE ALSO USED TO MONITOR AND TRANSMIT MPS HELIUM SYSTEM SAFETY DATA FOR LCC.

U.S. Gov t

PRINT DATE: 4/18/96 PAGE 6

FAILURE MODES EFFECTS ANALYSIS FMEA - CIL FAILURE MODE

NUMBER: 05-5-803-7-02

REVISION#:

10

04/01/96

SUBSYSTEM NAME: DATA PROCESSING SYSTEM (DPS)

LRU: MULTIPLEXER-DEMULTIPLEXER

CRITICALITY OF THIS FAILURE MODE: 1R2

ITEM NAME: MULTIPLEXER-DEMULTIPLEXER

FAILURE MODE:

ERRONEOUS OUTPUT

MISSION PHASE:

PL PRE-LAUNCH

LO LIFT-OFF

OO ON-ORBIT DO DE-ORBIT

LS LANDING/SAFING

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 ENDFAYOUR

CAUSÉ:

PIECE PART FAILURE, VIBRATION, CONTAMINATION, TEMPERATURE, CHEMICAL REACTION, ADDRESS CHECK FAILURE, DATA ERROR TO MDM MODULE, MDM MODULE/ CHANNEL SELECT FAILURE, OR ANALOG/DIGITAL (A/D) CONVERTER FAILURES.

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN - A) PASS

B) FAIL

C) PASS

PASS/FAIL RATIONALE:

A)

B١

FAILS SCREEN B BECAUSE SOURCE OF ERRONEOUS OUTPUT CANNOT BE IDENTIFIED AND MAY BE ACCEPTED AS A VALID DATA

C)

PAGE: 7 PRINT	DATE: 04/18/96
FAILURE MODES ETFLUIC TELLILYSIS (FMEA) — CIL FAILURE MODE NUMBER: 05-5-803-7- 0	02
- FAILURE EFFECTS -	
(A) SUBSYSTEM: LOSS OF MDM.	
(B) INTERFACING SUBSYSTEM(S): TRANSMISSION OF ERRONEOUS DATA BY THE FAILED MDM MAY RESULT MASTER ALARMS AND SYSTEM MANAGEMENT (SM) ALERTS.	IN NUMEROUS
(C) MISSION: POSSIBLE LOSS OF MISSION.	
(D) CREW, VEHICLE, AND ELEMENT(S): NO EFFECT FIRST FAILURE. POSSIBLE LOSS OF CREW/VEHICLE AFTER S FAILURE.	ECOND
(E) FUNCTIONAL CRITICALITY EFFECTS: CRITICALITY 1R2 BECAUSE OF THE FOLLOWING REASON:	
1) OA1 MOM FAILS GIVING ERRONEOUS OUTPUT VALUES FOR THE MPS HE PRESSURE LCC LIMITS. 2) ASSOCIATED REGULATOR FAILS OPEN AFTER TERMINATION OF AFT CONTINUES OF THE FAILURE IS NOT REFLECTED SUPPLY PRESSURE LCC (T-13 SECONDS); THE FAILURE IS NOT REFLECTED FAILED MOM OUTPUT TO TEM/GROUND. RESULATOR OUTLET PRESSURE LCC LIMITS CONTINUES UNTIL T-10 SECONDELIUM OUTPUT PRESSURE MEASUREMENTS (MPS E1-REG B. MPS E2-REG B) ARE CHANNELIZED THROUGH OA1. THE FAILED MOM WILL NOT REFAILED OPEN REGULATOR CONDITION. IF AN OA1 CHANNELIZED HELIUM REGULATOR FAILS OPEN AFTER T-13 SECONDITION HAS FAILED SUCH THAT REGULATORS PRESSURE ARE MASKED RESULTS ARE AN LCC DECEPTION AND LIFT OFF WITH FAILED OPEN REGULATOR WITH THIS CONDITION MAY RESULT IN OVERPRESSURIZATION OF COMPARTMENT (REF. 03-1CB-0743-01).	OMPARTMENT AND HELIUM ONDS THE GA. MPS E3- EFLECT THE CONDS AND O, THE GULATOR

-DISPOSITION RATIONALE-

(A) DESIGN:

PAGE: 8 PRINT DATE: 4/18/96

FAILURE MODES EFFECTS ANALYSIS (FILLA) - CIL FAILURE MODE

NUMBER: 05-5-803-7-02

- ALL PARTS SELECTED FROM MF0004-400 ORBITER PROJECT PARTS LIST (OPPL) WHICH CALLS FOR JANTXV LEVEL PARTS, OR HAVE ADEQUATE DERATING FACTORS OF 25-50% ON HYBRIDS & TRANSISTORS, 25-30% ON RESISTORS, CAPACITORS AND OTHER COMPONENTS. PARTS THAT DID NOT MEET ORBITER PROJECT PARTS LIST REQUIREMENTS FOR QUALIFICATION, TRACEABILITY SCREENING OR BURN-IN WERE REVIEWED AND WERE FOUND ACCEPTABLE FOR THEIR GIVEN FUNCTIONS. REDUNDANT COMMAND/SIGNALS FOR CRITICAL FUNCTIONS ROUTED THROUGH SEPARATE MOM'S. DESIGN ALSO INCORPORATES RELIABILITY, MAINTAINABILITY, ENVIRONMENTAL AND TRANSPORTABILITY REQUIREMENTS AND OTHER DESIGNS AND CONSTRUCTION PER SPECIFICATION MC615-0004.

(B) TEST:

EACH UNIT SUBJECTED TO ACCEPTANCE TEST PROCEDURE (ATP) TEST (T4025545) AT HONEYWELL INCLUDING CONTINUITY, FULL FUNCTIONAL, ACCEPTANCE VIBRATIONAL TEST (AVT), ACCEPTANCE THERMAL TEST (ATT), EXAMINATION OF PRODUCT, INSULATION RESISTANCE TEST, DIELECTRIC STRENGTH TEST, PERFORMANCE, AND POWER VARIATION TEST.

QUALIFICATION TEST (T4025763) COMPLETED AT HONEYWELL INCLUDING FULL FUNCTIONAL, POWER, ELECTROMAGNETIC COMPATIBILITY (EMC), HUMIDITY, THERMAL, VIBRATION, THERMAL VACUUM, LIGHTNING, SHOCK, SALT/FOG, 1000 ON/OFF CYCLE LIFE TEST, ACCELERATION, AND EXPLOSIVE/CORROSIVE ATMOSPHERE.

GROUND TURNAROUND TEST: ALL TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

RECEIVING INSPECTION

CERTIFICATIONS & SOURCE INSPECTION TEST REPORTS ARE ON FILE. CASES AND FLATPACKS ARE ENVIRONMENTALLY SCREENED, INCLUDING LOOSE PARTICLE DETECTION IN RECEIVING INSPECTION. ALL HYBRID COMPONENTS ARE LOT SAMPLED IN RECEIVING INSPECTION.

CONTAMINATION CONTROL

CLEANLINESS TO CLASS 100,000 LEVEL IS VERIFIED BY INSPECTION.

ASSEMBLY/INSTALLATION

VISUAL INSPECTION IS PERFORMED AT KIT RELEASE. PRINTED WIRING BOARD MICROSECTION ANALYSIS IS PERFORMED AND MONITORED BY INSPECTION, QUALITY CONTROL VERIFIES AND WITNESSES TORQUE OPERATIONS. QUALITY CONTROL VERIFIES SOLDERED CONNECTIONS AND ASSEMBLY OF PARTS. TOOL CERTIFICATION AND TENSILE TESTS ARE MAINTAINED. QUALITY CONTROL PERFORMS PRE-CAP VISUAL INSPECTION FOR CLEANLINESS. QUALITY CONTROL VERIFIES CONVEYOR FURNACE PROFILE/TEMPERATURE EVERY 90 DAYS. QUALITY CONTROL VERIFIES ALL FLATNESS & SURFACE ROUGHNESS FOR PROPER HEAT TRANSFER. THERMAL PROTECTION CONTROLS EXIST FOR ALL SOLDERED CONNECTIONS.

NONDESTRUCTIVE EVALUATION

RADIOGRAPHIC INSPECTION OF SELECTED COMPONENTS, I.E., TANTALUM. CAPACITORS, IS PERFORMED.

PAGE: 9 . PRINT DATE: 4/18/96

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE

NUMBER: 05-6-803-7-02

CRITICAL PROCESSES

INSPECTION VERIFIES CRIMPING OPERATIONS AND CERTIFICATION. SOLDERING REQUIREMENTS PER NHB5300.4(3A) ARE VERIFIED BY INSPECTION.

TESTING

ATP IS OBSERVED AND VERIFIED BY QUALITY CONTROL, INCLUDING AVT AND ATT.

HANDLING/PACKAGING

PROPER GROUNDING OF ELECTRICALLY STATIC SENSITIVE DEVICES WHEN HANDLING IS PERFORMED. PACKAGING AND PROTECTION VERIFIED BY INSPECTION.

(D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATABASE

(E) OPERATIONAL USE:

PORT MODING TO RECOVER MDM FUNCTIONALITY IS AVAILABLE DURING ALL MISSION PHASES.

- APPROVALS -

EDITORIALLY APPROVED

: RI

EDITORIALLY APPROVED

JSC

TECHNICAL APPROVAL

: VIA APPROVAL FORM

96-CIL-013 05-5